



NEWS from CPSC and HC

U.S. Consumer Product
Safety Commission
www.cpsc.gov

Health Canada
www.hc-sc.gc.ca



Health
Canada Santé
Canada

FOR IMMEDIATE RELEASE
November 23, 2009
Release # 10-046

Firm's Recall Hotline: (877) 274-0277
CPSC Recall Hotline: (800) 638-2772
CPSC Media Contact: (301) 504-7908
HC Media Contact: (613) 957-2983

Infant Entrapment and Suffocation Prompts Stork Craft to Recall More Than 2.1 Million Drop-Side Cribs

WASHINGTON, DC - The U.S. Consumer Product Safety Commission (CPSC), in cooperation with Stork Craft Manufacturing Inc., of British Columbia, Canada, today announced the voluntary recall of more than 2.1 million Stork Craft drop-side cribs, including about 147,000 Stork Craft drop-side cribs with the Fisher-Price logo. The recall involves approximately 1,213,000 units distributed in the United States and 968,000 units distributed in Canada.

CPSC urges parents and caregivers to immediately stop using the recalled cribs, wait for the free repair kit, and do not attempt to fix the cribs without the kit. They should find an alternative, safe sleeping environment for their baby. Consumers should contact Stork Craft to receive a free repair kit that converts the drop-side on these cribs to a fixed side.

The cribs' drop-side plastic hardware can break, deform, or parts can become missing. In addition, the drop-side can be installed upside-down, which can result in broken or disengaged plastic parts. All of these problems can cause the drop-side to detach in one or more corners. When the drop-side detaches, it creates space between the drop-side and the crib mattress. The bodies of infants and toddlers can become entrapped in the space which can lead to suffocation. Complete detachment of drop-sides can lead to falls from the crib.

CPSC, Health Canada, and Stork Craft are aware of 110 incidents of drop-side detachment; 67 incidents occurred in the United States and 43 in Canada. The incidents include 15 entrapments; 12 in the U.S. and three in Canada. Four of the entrapments resulted in suffocation: a 7-month-old in Gouverneur, N.Y.; a 7-month-old in New Iberia, La.; a 6-month-old in Summersville, W.Va.; and a 9-month-old in Bronx, N.Y. Included in these incidents are 20 falls from cribs; 12 in the U.S. and eight in Canada. Fall injuries ranged from concussion to bumps and bruises. The cribs involved in these incidents had plastic drop-side hardware that had broken, missing, or deformed claws, connectors, tracks, or flexible tab stops; loose or missing metal spring clips; stripped screws; and/or drop-sides installed upside-down.

This recall involves Stork Craft drop-side cribs and Stork Craft drop-side cribs with the Fisher-Price logo. This recall does not involve any cribs that do not have a drop-side. This recall does not involve any cribs with metal rod drop-side hardware. It involves only those cribs with plastic trigger and one-hand-system drop-side hardware.

This recall includes Stork Craft cribs with manufacturing and distribution dates between January 1993 and October 2009. This recall also includes Stork Craft cribs with the Fisher-Price logo that have manufacturing dates between October 1997 and December 2004. The Stork Craft cribs with the Fisher-Price logo were first sold in the U.S. in July 1998 and in Canada in September 1998. The cribs were sold in various styles and finishes. The manufacture date, model number, crib

name, country of origin, and the firm's name, address, and contact information are located on the assembly instruction sheet attached to the mattress support board. The firm's insignia "storkcraft baby" or "storkling" is inscribed on the drop-side teething rail of some cribs. In Stork Craft cribs that contain the "Fisher-Price" logo, this logo can be found on the crib's teething rail, in the manufacturer's instructions, on the assembly instruction sheet attached to the mattress support board, and on the end panels of the Twinkle-Twinkle and Crystal crib models.

Major retailers in the United States and Canada sold the recalled cribs including BJ's Wholesale Club, J.C. Penney, Kmart, Meijer, Sears, USA Baby, and Wal-Mart stores and online at Amazon.com, Babiesrus.com, Costco.com, Target.com, and Walmart.com from January 1993 through October 2009 for between \$100 and \$400.

The cribs were manufactured in Canada, China and Indonesia.


For additional information, contact Stork Craft toll-free at (877) 274-0277 anytime to order the free repair kit, or log on to www.storkcraft.com

Important Message from CPSC:

CPSC would like to remind parents not to use any crib with missing, broken, or loose parts. Make sure to tighten hardware from time to time to keep the crib sturdy. When using a drop-side crib, parents should check to make sure the drop-side or any other moving part operates smoothly. Always check all sides and corners of the crib for disengagement. Any disengagement can create a gap and entrap a child. In addition, do not try to repair any side of the crib, especially with tape, wire or rope.

Note: Health Canada's press release can be seen at http://cpsr-rspsc.gc.ca/PR-RP/recall-retrait-eng.jsp?re_id=888

For more information on Crib Safety, visit CPSC's [Crib Information Center](#)

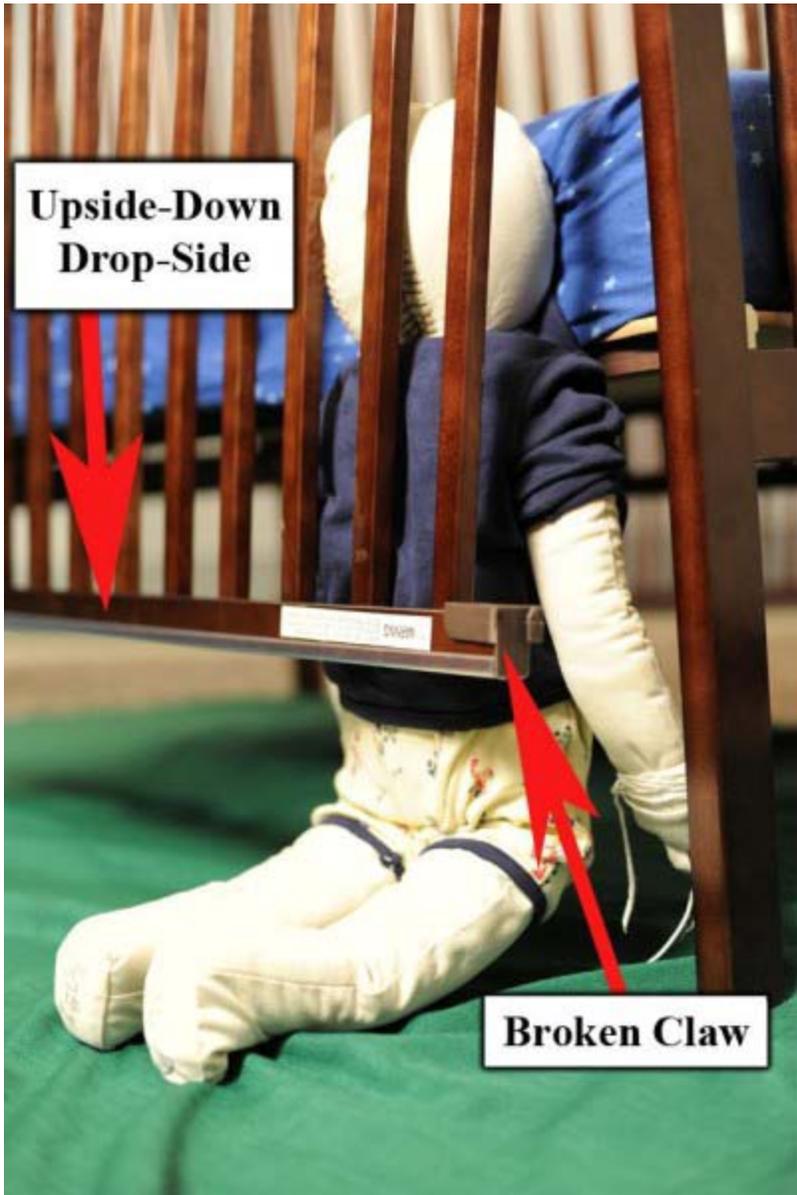

**Upside-Down
Drop-Side**


Broken Claw



ONE HAND SYSTEM

MODEL NUMBER/NO. DE MOBILE: 04830-615 -- 6745 EDGEMOND CRIB-ONS-MAT. STAIN DATE: JUNE 3, 2001 PRODUCT OF CANADA/PRODUIT DU CANADA	 <small>© 2001 Fisher-Price, Inc. A subsidiary of Mattel Inc., East Aurora, NY 14052. Fisher-Price trademarks are used under license from Fisher-Price, Inc. manufactured and distributed by Stork Craft Mfg. Inc., Richmond, B.C. © Fisher-Price Inc. 2001 est un sous-produit de Fisher Inc., East Aurora, NY 14052. Les marques Fisher-Price est licenciée de Fisher-Price, Inc. Sous licence et distribué par Stork Craft Mfg. Inc., Richmond, B.C.</small>
---	--

(Fisher Price label is on the assembly instruction sheet attached to the mattress support board)

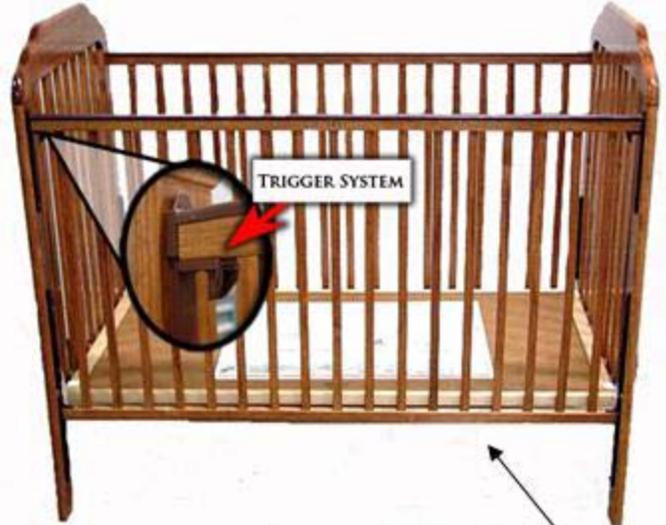

TRIGGER SYSTEM

STORAGE AND CARE CONSERVATION DU COTÉ DE BOIS	
<small>DISJECT sections are not to be stored with water present, including the T-rails and wheels. The stationary side rail, mattress base and other side rail set are to be disassembled for storage. Always review the assembly instructions for each and remove the order to disassemble. When removing the side rail set, do not to press the side rail set into the bottom T-rail or to the stop side rail to all the way up before disassembly. Wash of parts with a dampened clean cloth. DO NOT use abrasives.</small>	
<small>Conservation: ne pas stocker les sections avec de l'eau présente, y compris les rails T et les roues. Le rail latéral fixe, la base du matelas et les autres rails latéraux doivent être démontés pour le stockage. Consultez toujours les instructions d'assemblage pour chaque partie et retirez-les pour le démontage. Lorsque vous retirez le rail latéral, ne appuyez pas le rail latéral sur le rail inférieur T ou sur le rail latéral d'arrêt à tout le long de la hauteur avant le démontage. Nettoyez les pièces avec un chiffon humide propre.</small>	
<small>Distributed by / Distributeur par</small> Stork Craft Mfg. Inc. <small>1425 Neilson Road, Richmond, BC V6V 1G2</small>	MODEL NUMBER/NO. DE MOBILE: 04588-478* <small>Manufactured under license from</small> ER DATE: JAN 1 2008 MADE IN CANADA STORK CRAFT MFG. INC. <small>1425 NEILSON ROAD RICHMOND, BC V6V 1G2</small>

(Stork Craft label is on the assembly instruction sheet attached to the mattress support board)